

nVent ERICO Cadweld Welded High-Voltage Power Connections

For Underground and Subsea Cable Splicing






TABLE OF CONTENTS

INTRODUCTION	2 - 3
CADWELD HIGH-VOLTAGE WELDING PROCESS	
CADWELD ELECTRICAL & MECHANICAL PERFORMANCE	
CADWELD WELDING EQUIPMENT	
EASY TO MAKE CADWELD CONNECTIONS	
PRODUCT OVERVIEW ALUMINUM A22 WELDS	
PRODUCT OVERVIEW COPPER F20 WELDS	
IMPORTANT NOTES	

nVent Engineered Electrical & Fastening Solutions is a leading global manufacturer and marketer of superior engineered products for niche electrical, mechanical and concrete applications. These nVent products are sold globally under a variety of market-leading brands: nVent ERICO welded electrical connections, facility electrical protection, and rail and industrial products; nVent CADDY fixing, fastening and support products; nVent ERIFLEX low voltage power and grounding connections; and nVent LENTON engineered systems for concrete reinforcement.

For more information please visit nVent.com/ERICO.

INTRODUCTION

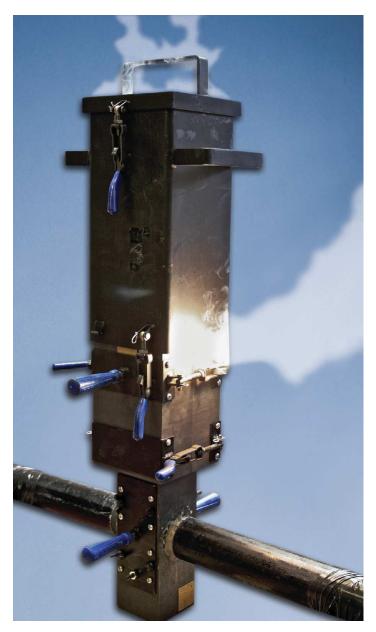

BETTER THAN MECHANICAL CONNECTIONS AND LESS LABOR AND COST INTENSIVE THAN MIG OR TIG.

Cadweld high-voltage welds are permanent molecular bonds that cannot loosen or deteriorate, no maintenance is required and no resistance increase over time, so there is a continuous optimal electrical path. This makes Cadweld connections superior to traditional compression or mechanical connections that provide only surface contact between conductors and a less-than-perfect current path. In addition, Cadweld high-voltage welding system is easier to use and lower in labor cost, since you don't need a certified welder.

Full on site training can be provided by nVent Engineers.

A LOW EMISSION PROCESS

Cadweld high-voltage welding set-up uses a unique ceramic fiber smoke filter system which prevents sparks and produces minimal smoke, but also reduces dust and other emissions to an acceptable level for exposures, even if used in unventilated small rooms and cable tunnels.

Cadweld High-Voltage Welding Process

CADWELD WELDING IS A RELIABLE METHOD OF QUICKLY MAKING ELECTRICAL CONNECTIONS.

Optimum Standardization:

Welding equipment (crucible, smokefilter body, frames, etc.) is standardized and can be used on all connections. Only different molds and different types of welding material are needed for Copper or for Aluminum welds.

Cadweld connections give you a single process for making all cable-to-cable, splices and terminations, tubular bus and flat bus connections.

Two different welding material options allow Cu-Cu as well as Al-Al and Al-Cu* connections.


The welding material contains either copper and aluminum oxide or aluminum and calcium sulfate, both with additional ingredients.

The ignitor starts an exothermic reaction inside the crucible, producing the molten copper or molten aluminum. The molten material then flows from the crucible into the mold, welding the ends of the conductors to create the molecular bond.



CADWELD HIGH-VOLTAGE SYSTEM ADVANTAGES:

- · Cadweld high-voltage welding system will weld the following materials:
- Standard Al or Cu cable (concentric)
- Segmented AI or Cu cable (milican)
- Solid Al or Cu cable
- · Cadweld connections can be made easily with minimal training.
- Cadweld weld is small only 70 mm of insulation is removed from each cable end and therefore is easy to re-insulate.
- Specially designed weld profile for high-voltage applications.
- · No external power or heat source required.
- Has a current carrying capacity equal to that of the conductor.
- · Permanent molecular bond will not deteriorate with age, cannot loosen or corrode.
- Will withstand repeated faults, is made with lightweight equipment, has low labor cost and is time saving on jobsites.

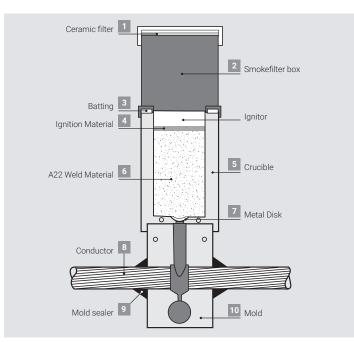

*For Al-Cu connections, Copper must be tinned.

Cadweld Electrical & Mechanical Performance

TECHNICAL INFORMATION:

Strength Results

In laboratory tests, the tensile strength of Cadweld high-voltage cable connections proved to have overall strong results. The tests show on average that the Cadweld connection provides about 75% tensile strength compared to the cable by itself. Test results vary between approx. 60% up to 90% tensile strength, whereby the breaking point is annealed cable at the edge of the Cadweld weld.

Performance Results

Like all Cadweld connections, their permanent low resistivity provides a current-carrying capacity that's greater than the conductors.

PERFORMANCE RESULTS

Aluminum Conductor	Resistance in μΩ	
Cable		
Cable-to-Cable Connection	A22	64.01
Cable Only		64.43

RANGE OF CAPABILITIES

Conductor	Conductor Range	Connection Application			
Al-cable to Al-cable or solid cable	17 mm / 56 mm diameter	 High-, medium- and low-voltage 			
		 High current electrical 			
		• Earthing			
Cu-cable or Al-cable to Cu-cable	17 mm / 64 mm diameter	High-, medium- and low-voltage			
		· High current electrical			
		• Earthing			
Al-solid cable, -lug, busbar or flexible connections in Al-Al or Al-Cu	Customized to	High current			
	meet application	 Electrical connections for electrolysis and chemical plants 			

^{*}Other cable sizes and combinations also available, please contact your nVent engineer.

CONNECTION EXAMPLES:



Terminations: Copper 'Top Bolt' on Aluminum solid cable



Connection between two Aluminum cables



Cadweld Welding Equipment




Cadweld molds are produced from graphite blocks and can be used for 50 or more welds. Molds for Al-Al and Al-Cu are different from Cu-Cu molds. Frames are needed in order to close the mold and hold it. Mold Sealer is required around the cable on the outside of the Cadweld mold to prevent leakage of molten weldmetal.



Cadweld crucibles are included in the mold design for smaller conductor diameters. Large welds will require a separate crucible in order to accept the required amount of welding material. Frames are needed in order to close the crucible and hold it.



Cadweld high-voltage connection set-up uses a unique ceramic fiber smoke filter system which prevents sparks and produces minimal smoke. Filters can be used only once, but replacement filter sets are available for both sizes of smokefilter box.

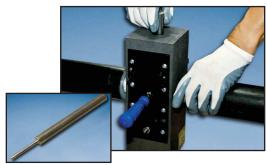

Cadweld Gap device is a tool to correctly "gap" and center the cable ends. The tool kit provides brushes and other items which are used for easy cleaning of conductors before making connections. Cadweld Air-Dry Flux T327A is used on Al-Al and Al-Cu connections immediately after cleaning the aluminum conductors with the brush. Cadweld Air-Dry Flux must be lightly sprayed on to prevent re-oxidation.



Cadweld welding material is a mixture of copper, aluminum and other ingredients. Each bag or container contains sufficient welding material for the specified connection. Cadweld welding material cannot ignite spontaneously. It can be handled and stored without danger. Adding starting material to the welding material is necessary to begin the exothermic reaction.

Easy To Make Cadweld Connections

BEFORE WELDING: READ, UNDERSTAND AND FOLLOW ALL SAFETY INSTRUCTIONS PACKAGED WITH YOUR MOLD!



- Dry the mold and the conductors
 - · Clean the conductors
 - · Place cable ends in the mold



- · Correctly "gap" and center cable ends
 - · Close the handles to lock the mold
 - Drop the metal disk into the mold



- · Dump the welding material into the mold
 - · Sprinkle the starting material over the welding material and onto the lip of the mold (different for larger conductor sizes – follow instruction packaged with your mold)



- · Attach and fit the smokefilter box and ignite
 - Open the mold after approximately 5 minutes when material has solidified
 - Remove the mold from completed weld



- A completed Cadweld connection 5
 - Will not loosen or increase resistance over lifetime of installation

Detailed instructions and safety precautions are provided with every Cadweld mold. You must read and understand all instructions before making a connection. If you have any questions, please contact an nVent engineer for assistance. Instruction sheets are also available for download at nVent.com/ERICO.

Product Overview Aluminum A22 Welds

Cable Ø	(mm)	MOLD			CRUCIBLE		SMOKEFILTER		GAP	TOOL	Al-	Welding Material	Star-
from	to	Туре	Frame	Sealer	Туре	Frame	House	Set	Device	KIT	FLUX	Code (Gramms)	Ignitor
17.1	18.0	S1V18M									300A22		
18.1	19.0	S1V19M										300A22	
19.1	20.0	S1V20M							C			300A22	
20.1	21.0	S1V21M										300A22	
21.1	22.0	S1V22M						(0	CL-GD-3			400A22	1
22.1	23.0	S1V23M				- NR	S	SFS-102-F20-SR	ω̈́			400A22	
23.1	24.0	S1V24M			- N R		SF-102-SR					400A22	
24.1	25.0	S1V25M			R -							400A22	
25.1	26.0	S1V26M										400A22	1
26.1	27.0	S1V27M										500A22	Yes
27.1	28.0	S1V28M								TS-SR	T327A	500A22	
28.1	29.0	S1V29M										500A22	
29.1	30.0	S1V30M										500A22	
30.1	31.0	S1V31M										500A22	
31.1	32.0	S1V32M										600A22	
32.1	33.0	S1V33M										700A22	
33.1	34.0	S1V34M										800A22	
34.1	35.0	S1V35M	IJ									800A22	
35.1 36.1	36.0 37.0	S1V36M S1V37M	1-10	T403								800A22 800A22	
37.1	38.0	S1V37M	FM-102-SR) 3								1000A22	
38.1	39.0	S1V39M	,									1000A22	
39.1	40.0	S1V40M										1000A22	1
40.1	41.0	S1V41M						(0				1000A22	
41.1	42.0	S1V42M										1100A22	
42.1	43.0	S1V43M					<u>S</u>	FS-				1100A22	
43.1	44.0	S1V44M					SF-158-SR	158-				1100A22]
44.1	45.0	S1V45M					8-8	-F2(1200A22	
45.1	46.0	S1V46M					77	SFS-158-F20-SR	CF.			1200A22	
46.1	47.0	S1V47M			Ç.			~	CL-GD-6			1300A22	
47.1	48.0	S1V48M			2-15	FC			-6			1300A22	
48.1	49.0	S1V49M			CR-158-128-SR	FC-158-SR						1400A22	
49.1	50.0	S1V50M			28-8	8-SF						1400A22	
50.1	51.0	S1V51M) R	~						1400A22	
51.1	52.0	S1V52M										1400A22	
52.1	53.0	S1V53M										1400A22]
53.1	54.0	S1V54M										1700A22	
54.1	55.0	S1V55M										1900A22]
55.1	56.0	S1V56M										2000A22	

Notes:

- For Al-CU connections, copper cable or termination must be tinned
- Cadweld A22 welds (Al-Al / Al-CU) are for indoor use only
- All A22 welds require Al-FLUX
- Standard range shown, for different sizes/combinations please contact an nVent engineer


Product Overview Copper F20 Welds


Cable		MOLD	F	0		CIBLE	SMOKE		GAP	TOOL	Welding Material	Star-		
from	to	Type	Frame	Sealer	Туре	Frame	House	Set	Device	KIT	Code	Ignitor		
17.1	18.0	SS-18-SR									P98F20	-		
18.1	19.0	SS-19-SR									P98F20 P98F20			
19.1	20.0	SS-20-SR SS-21-SR									P99F20			
21.1	22.0	SS-21-SR SS-22-SR									P99F20			
22.1	23.0	SS-23-SR									P99F20			
23.1	24.0	SS-24-SR			1						P99F20			
24.1	25.0	SS-25-SR					(0	SFS			P99F20			
25.1	26.0	SS-26-SR				1	SF-102-SR	SFS-102-F20-SR	은		P100F20			
26.1	27.0	SS-27-SR			- Z/Z	- N/N	02-	2-F	CL-GD-3		P100F20	-		
27.1	28.0	SS-28-SR				1	SR SR	20-	ယ်		P100F20			
28.1	29.0	SS-29-SR						SR			P100F20			
29.1	30.0	SS-30-SR									P101F20			
30.1	31.0	SS-31-SR									P101F20			
31.1	32.0	SS-32-SR									P101F20	Yes		
32.1	33.0	SS-33-SR									P101F20			
33.1	34.0	SS-34-SR		Т40							P101F20			
34.1	35.0	SS-35-SR									P103F20			
35.1	36.0	SS-36-SR									P103F20			
36.1	37.0	SS-37-SR			T403						P103F20			
37.1	38.0	SS-38-SR					(0)				P103F20			
38.1	39.0	SS-39-SR									P104F20			
39.1	40.0	SS-40-SR	_ F ≤					SFS-158-F20-SR		TS-SR	P104F20			
40.1	41.0	SS-41-SR	FM-102-SR								P104F20			
41.1	42.0	SS-42-SR	1-SF	ω							P104F20			
42.1	43.0	SS-43-SR	~								P105F20			
43.1	44.0	SS-44-SR									P105F20			
44.1	45.0	SS-45-SR									P105F20			
45.1	46.0	SS-46-SR									P105F20			
46.1	47.0	SS-47-SR									P105F20			
47.1	48.0	SS-48-SR			유						P105F20			
48.1	49.0	SS-49-SR					CR-158-128-S	FC-158-SR	SF-158-SR	-15	은		P106F20	
49.1	50.0	SS-50-SR					8-1	158	158	« ₋ Π	CL-GD-6		P106F20	_
50.1	51.0	SS-51-SR			18-8	-SR	SR.	20-	6		P106F20			
51.1	52.0	SS-52-SR			X			SR			P107F20			
52.1	53.0	SS-53-SR									P107F20			
53.1	54.0	SS-54-SR									P108F20			
54.1	55.0	SS-55-SR									P108F20			
55.1	56.0	SS-56-SR									P108F20			
56.1	57.0	SS-57-SR	_								P108F20			
57.1	58.0	SS-58-SR									P108F20	-		
58.1	59.0	SS-59-SR	_								P110F20			
59.1	60.0	SS-60-SR									P110F20			
60.1	61.0	SS-61-SR									P110F20			
61.1	62.0	SS-62-SR									P110F20			
62.1	63.0	SS-63-SR	_								P110F20			
63.1	64.0	SS-64-SR									P110F20			


Notes:

- For horizontal straight splice or termination to 'Top Bolt' connections
- · Cadweld F20 molds require Mold Sealer
- · Molds make approx. 60 connections/welds
- Standard range shown, for different sizes/combinations please contact an nVent engineer


IMPORTANT NOTES

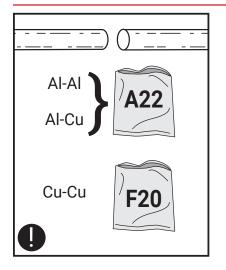

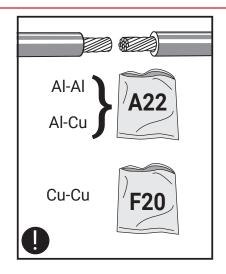


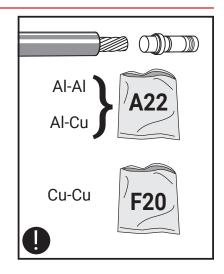


nVent offers welding material for different conductors. Please note that any Al-Cu or Al-Al connections require Cadweld A22 welding material. Cu-Cu connections will be processed with Cadweld F20 welding material.

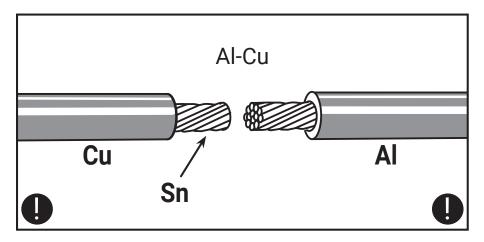

To provide a reliable connection between Al and Cu, the Cadweld welding process will require only tinned copper conductors.

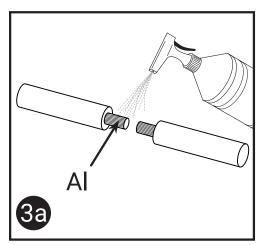


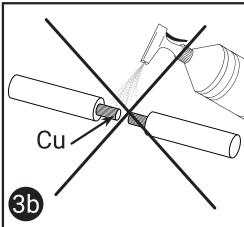

Immediately after cleaning aluminium conductors, use Cadweld Air Dry Flux T327A to prevent re-oxidation of the cleaned aluminium surface. There is no requirement to use Cadweld Air Dry Flux on copper conductors.


BEFORE WELDING: Read, understand and follow all safety instructions packaged with your mold. Refer to instruction sheet IP 8067-A, which is also available at nVent.com/ERICO for download.

IMPORTANT NOTES

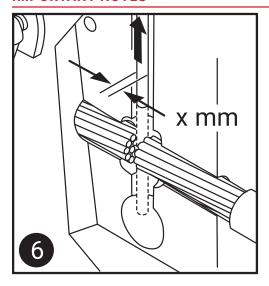


Please make sure that you maintain the correct "gap" between conductors inside the mold. This will allow the molten welding material to flow and connect the conductor. The number of the GAP Device shown on product overview pages 8 & 9 indicates the correct "gap".

If you are not sure or have additional questions, please contact an nVent engineer prior to any welding operation.

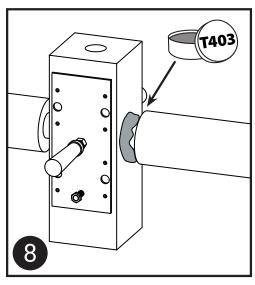

Apply (mold) sealer T403 between the mold and conductor to prevent leaking molten weld material.

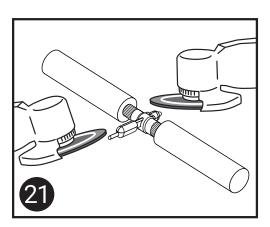

Remove risers and overflow at the Cadweld weld once material is solidified.

BEFORE WELDING: Read, understand and follow all safety instructions packaged with your mold. Refer to instruction sheet IP 8067-A, which is also available at nVent.com/ERICO for download.



Our powerful portfolio of brands:

CADDY ERICO HOFFMAN RAYCHEM SCHROFF TRACER



nVent.com/ERICO

WARNING: nVent products shall be installed and used only as indicated in nVent's product instruction sheets and training materials. Instruction sheets are available at nVent.com/ERICO and from your nVent customer service representative. Improper installation, misuse, misapplication or other failure to completely follow nVent's instructions and warnings may cause product malfunction, property damage, serious bodily injury and/or death, and void your warranty.

©2018 nVent. All nVent marks and logos are owned or licensed by nVent Services GmbH or its affiliates. All other trademarks are the property of their respective owners nVent reserves the right to change specifications without notice.